


HSV R2	M8		M10		M12		M16	
	h_{nom1}	h_{nom2}	h_{nom1}	h_{nom2}	h_{nom1}	h_{nom2}	h_{nom1}	h_{nom2}
h_{nom} [mm]	40	50	51	61	62	77	81	96
h_{min} [mm]	100	100	100	120	140	140	130	170
S_{min} [mm]	60	60	70	70	80	80	120	100
C_{min} [mm]	60	60	70	70	90	90	120	100
d_f [mm], min	9		12		14		18	
h_1 [mm], min	45	55	60	70	70	85	90	105
d_0 [mm]	8		10		12		16	
SW [mm]	13		17		19		24	
T_{inst} [mm]	15		30		50		100	



	$t_{fix, max}$ [mm]	
	h_{nom1}	h_{nom2}
M8 x 75	20	10
M10 x 90	20	12
M10 x 100	30	22
M12 x 100	15	5
M12 x 120	35	25
M12 x 150	65	55
M16 x 140	32	18

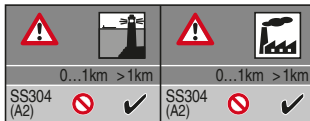